
Document ID: 1938001 Page 1 of 2

2008 HUMMER H2 | H2 (VIN N) Service Manual | HVAC | HVAC - Automatic | Repair Instructions |

Document ID: 1938001

Instrument Panel Inflatable Restraint Module Replacement



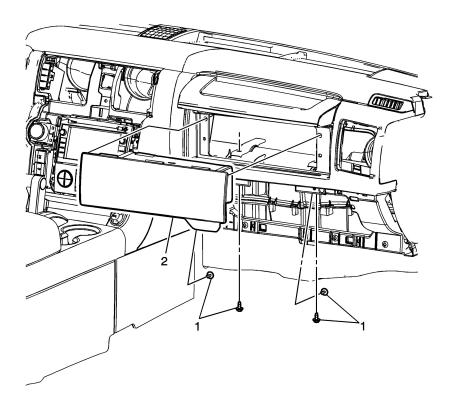

Callout

Component Name

Caution: Refer to <u>SIR Inflator Module Handling and Storage Caution</u> in the Preface section.

Caution: Refer to SIR Caution in the Preface section.

Preliminary Procedure

- Disable the SIR system. Refer to <u>SIR Disabling and Enabling</u> .
- Remove the instrument panel center air outlet bezel. Refer to <u>Instrument Panel</u> <u>Center Air Outlet Bezel Replacement</u>.
- Remove the right instrument panel outer air outlet bezel. Refer to <u>Instrument Panel</u> Outer Air Outlet Bezel Replacement - Right Side .
- Remove the instrument panel compartment door opening frame . Refer to <u>Instrument Panel Compartment Door Opening Frame Replacement</u> .
- Instrument Panel Inflatable Restraint Module Bolt (Qty: 4)
 © 2020 General Motors Corporation. All rights reserved.

Document ID: 1938001 Page 2 of 2

Notice: Refer to Fastener Notice in the Preface section.

Tighten
10 N·m (89 lb in)

Instrument Panel Inflatable Restraint Module Assembly

Procedure

• Disconnect the electrical connections.
• Ensure that the instrument panel inflatable restraint module is fully deployed before disposal. If the module was replaced under warranty, fully deploy and dispose of the module after the required retention period. Refer to Inflator Module Handling and Scrapping.
• Enable the SIR system. Refer to SIR Disabling and Enabling.